



GOVERNMENT OF KARNATAKA

OFFICE OF THE
CHIEF FIRE OFFICER
Karnataka State Fire and
Emergency Services,
HUBBALLI-25

C.NO.98/ADV/CFO/HBL/2021

Date : 20-07-2021

To,
The Principal
Shri Basaveshwar Temple International School
Basavan Bagewadi Taluk, Vijayapur District

Sir,

Sub : Issue of 'Fire safety recommendation/Advice' to Shri Basaveshwar Temple International School, Sy.No.1308/1 to 8A-6-G-22, Basavan Bagewadi Taluk, Vijayapur District.

Ref : 1) Applicants request letter dated 16/07/2021
2) C.No.16/DFO/VJP/2021-22 Dated 17/07/2021

._*._*._*._*._*._


With reference to the subject above cited, the premises of Shri Basaveshwar Temple International School building consisting with ground floor + 1 upper floor situated Sy.No.1308/1 to 8A-6-G-22, Basavan Bagewadi Taluk, Vijayapur District was inspected by the District Fire Officer, Vijayapur on 16/07/2021 with respect to Fire prevention, Fire fighting and Evacuation measures to be complied in the above premises and has submitted the details as under.

ANNEXURE-1
(Up to 14.99 mtrs. in height)
Group B Education Building

NBC-2016, Part-4, Table 7 (11) 3.1.3 Group B Educational Buildings sub division B1 & B2.
(These condition are indicative and not exclusive all relevant provisions related to fire and life safety of NBC 2016 are mandatory)

A. Details of the building / premises :-

01	Name and Address of the Applicant.	:	The Principal Shri Basaveshwar Temple International School Basavan Bagewadi Taluk, Vijayapur District
02	Name and Address of the premises.	:	Shri Basaveshwar Temple International School Sy.No.1308/1 to 8A-6-G-22, Basavan Bagewadi Taluk, Vijayapur District

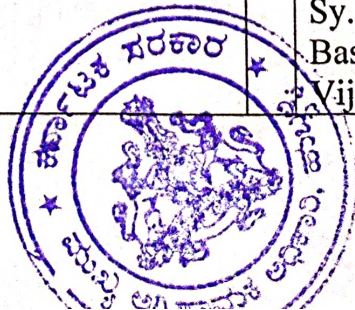


03	Name and address of the Building owner		The Principal Shri Basaveshwar Temple International School Basavan Bagewadi Taluk, Vijayapur District
04	Number of buildings	:	01
05	Number of floors	:	Ground Floor + 1 Upper Floor
06	<u>Floor-wise details of occupancy:-</u>		
	Ground floor	:	10 nos. of Class Room, 02 nos. of Office Room, Library
	First floor	:	10 nos. of Class Room, 02 nos. of Office Room, Library
07	Height of the building	:	07.20 Mtrs.
08	Site area	:	2428.99 Sq. Mtrs.
09	Built-up area of each floor:-		
	Ground floor	:	1285.00 Sq. Mtrs.
	First floor	:	1285.00 Sq. Mtrs.
10.	Total built-up area	:	2570.00 Sq. Mtrs.
11.	<u>Surrounding properties:-</u>		
	East	:	Play Ground
	West	:	Temple
	North	:	Agriculture Land
	South	:	Approach Road
12.	<u>Set-back area available around the building :-</u>		
	East	:	03.00 Mtrs.
	West	:	03.00 Mtrs.
	North	:	20.00 Mtrs.
	South	:	02.00 Mtrs
	Allowed setbacks (open space) should be maintained free from further obstruction / construction		


Note : Recommended to provide and maintain setbacks as per Local ZR.

B. On inspection of this Educational premises, the following fire prevention, fire fighting and evacuation measures recommended are considered absolutely essential from fire safety point of view :


Sl. No. (1)	Details (02)	Existing (03)	Recommendations (04)
01.	Accessibility to the premises	The premises is abutting by 09.00 mtrs. wide hard surfaced road located on Southern side.	Adequate

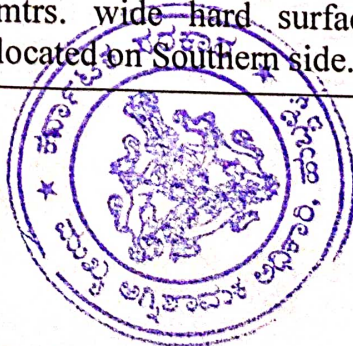

02.	No. of entrances	01 no. of entry & 01 no. of exit.		Recommended to provide at least 1 entry & 1 exit.
03.	Width of entry / exit	Entry 07.00 mtrs Exit 03.00 mtrs.		Adequate Minimum 06.00 mtrs. width with height clearance of minimum 05.00 mtrs. from ground level.
04.	Diesel generators.	---		Recommended to provide Diesel Generator of adequate capacity.
05.	No. of staircases available	Nos. of staircases	: 02	Recommended to provide staircases maintaining travel distance with 22.50 mtrs. with minimum 02.00 mtrs. width, 30 mm treads width, 15 mm treads height, 1 mtr. Handrail, with minimum 02.20 head room clearance.
		Width of staircases	: 1.36 mt	
		Width of treads	: 30 cm	
		Height of risers	: 15 cm	
		Nos. of riser per flight	: 14	
		Height of handrails	: 0.90 mt	
		Head room clearance	: 2.20 mt	
06.	No. lifts and capacity.	Nos. of lifts	: --	---
		Capacity of lifts	: --	
07.	Fire extinguisher	Provided 04 nos. of ABC fire extinguishers of 04 kg capacity.		A. One water mist extinguisher of 9 ltrs capacity should kept near each staircase landing. B. One mechanical foam extinguisher of 9 ltrs. capacity & One ABC type extinguisher of 6 kgs. capacity should be provided near diesel generator. C. One CO2 type fire extinguisher, of 4.5 kgs. capacity should be provided near each electrical panel board & electrical room. D. One ABC type fire

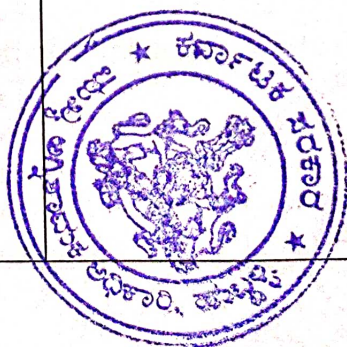

			extinguisher of 06 kgs capacity should be located as to be available within 15 mtrs. radius.
08.	Public address system	---	Not required as the risk is low.
09.	First aid Hose reel hose.	---	One Hose Reel Hose near the staircase (One hose reel hose system for every 1000 Sq. Mtrs.). The hose reel hose of min. 19 mm size and of adequate length to reach the farthest point of each floor should be provided shut off branch having a nozzle of 5mm size. The hose reel hose should be connected at each landing of each building/block/wing/tower.
10.	Automatic sprinkler system.	---	Not required as there is no basement.
11.	Terrace tank over respective tower terrace.	Provided 05 no. of Overhead tank each of 1000 ltrs. capacity & 01 no. of U/G tank of 6000 ltrs. capacity.	Terrace tank required 10,000 ltrs. Capacity (The water tank should be kept exclusively fire fight purpose)
12.	Pump at the terrace tank level with minimum pressure of 3.5 kg/cm ² .	---	Recommended to provide booster pump of 450 lpm capacity.
13.	Fire control room at ground floor.	---	Recommended to provide fire control room at the entrance/security room.
14.	Escape routes	---	Recommended to Provide Direction in which the employees/Students should have to move in the event of any emergency have been marked with luminous paint at each floor directing the employees

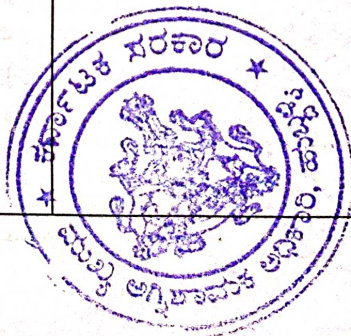

			towards emergency exits.
15.	Fire order	---	Fire safety plans has to be indicated with details of actions to be taken in case of an emergency near staircase landings at each floor with telephone numbers of Basavan Bagewadi fire station i.e., 08358-244101 & 101 telephone numbers of the nearest Ambulance service & Police Station.
16.	No smoking board	---	COPTA Sec-4 direction No Smoking area smoking here is an offence board should be written in English & Kannada both language shall be prominently displayed at inside the entry/exit of the each floor.
17.	Fire fighting training	---	At-least 40% of employees shall be got trained in basic fire fighting at R.A.Mundkur fire & Emergency Services Academy, Bannerughatta road, Bangalore within 3 months or at an early date. And shall be submitted to this office.
18.	Fire precautionary measures:- A. Explosive and flammable materials should not be stored in the store room, UPS room, Electrical panel area, class rooms, laboratory & electrical sum panel premises. B. Accumulation of combustible waste in and around the premises should be avoided. C. The exit ways shall be always kept clear without any obstruction. D. Liquefied petroleum gas should not be stored in the building. E. The doors shall not be kept locked/latched during working hours and shall be free from obstruction.		



	F. During the class hours the class room doors shall not be locked from inside to outside.
	G. As per Hon'ble supreme court order all teachers and staffs shall be trained to handle safety equipment, initiate emergency evacuation and protect their students in the event of fire and other emergency and the school shall observe the Fire Safety Day on April 14 th of every year by conducting Fire Safety drills with co-ordinate with fire service department.

The Karnataka Fire & Emergency Service Department is issued the Fire Safety recommendations in compliance to the undersigned, within 90 days.

❖ All requirements recommended above are as per National Building Code-2016 Part-4 clause 3.1.4 of Fire and Life safety will have to be complied with mandatorily.

From the above details it is clear that the 'Management' of the above Educational building have been recommended to provide fire precautionary measures as per National Building Code 2016, Part-4, Table 7 (11) 3.1.3 Group B Educational Buildings Sub division B1 & B2. After full-filling the above recommendations, a Certificate should be obtained by this office. *If at any time any of the conditions are found not complied with, this Certificate shall stand withdrawn/cancelled..*

Hence, On the report submitted by the District Fire Officer Vijayapur this recommendation certificate is issued to Shri Basaveshwar Temple International School building consisting with ground floor + 1 upper floor situated Sy.No.1308/1 to 8A-6-G-22, Basavan Bagewadi Taluk, Vijayapur District.

This certificate is valid for a period of one year from the date of issue of this letter and is renewable.



Yours faithfully,

[Signature]

20/7/2021

CHIEF FIRE OFFICER
Karnataka State Fire and
Emergency Services, Hubballi Zone
HUBBALLI-25

Copy to the District Fire Officer Vijayapur.